

Preliminary Specification of COAXIAL CONNECTOR

Part Number : TSC3489PV

2. USE THIS PRODUCTS

2.1 The directions for attachment to measurement machine.

The probe must be attached to machine at the two screw holes in probe flange. (Figure 2)

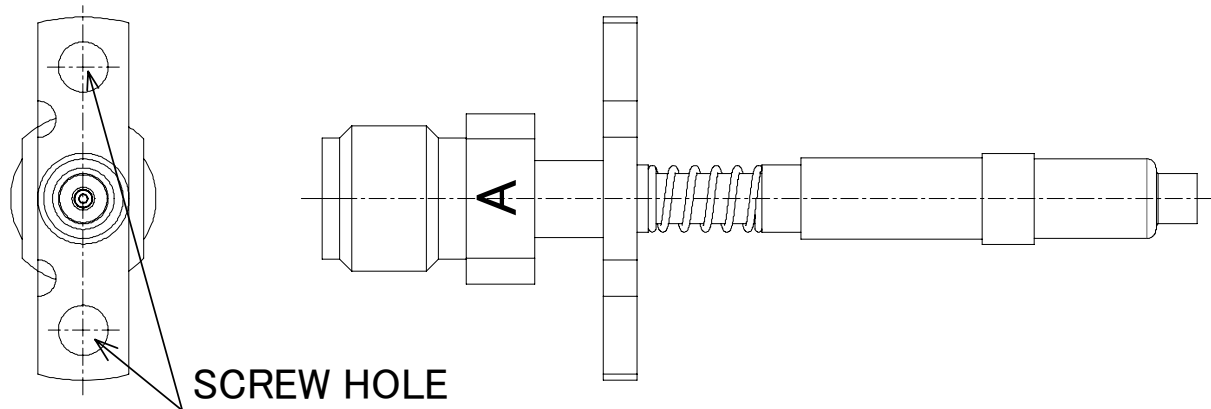


Figure.2 Screw hole position

3.2 The tolerance of position against MM8930-2620B.

3.2.1 Probe has the centering function by itself, $\pm 0.5\text{mm}$ is permitted against the hole center of MM8930-2620B.

Please avoid needless force to SMA connector to come back the original position when disengagement of probe. To avoid the needless force, we recommend using extension cable assembly, MXHR87HR3000. The instruction of the MXHR87HR3000 is as Figure 3.

There is the possibility, following function $\pm 0.5\text{mm}$ is not permitted against the hole center of MM8930-2620B, when probe effects the needless force.


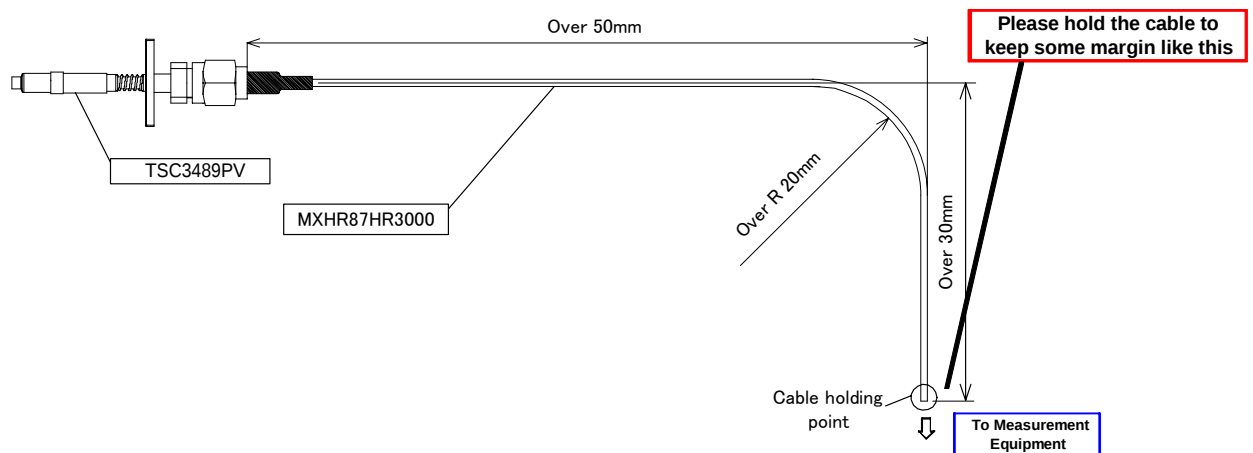


Figure.3 Instruction of MXHR87HR3000

Preliminary Specification of COAXIAL CONNECTOR

Part Number : TSC3489PV

3.2.2 To get the 15dB or higher isolation (up to 6GHz), The engagement strokes from the flange to the tip of probe is **23.1mm to 23.6mm**. (Figure 4)

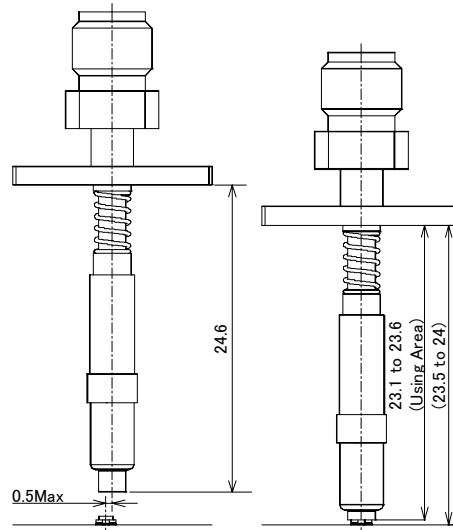


UNIT: mm

Figure.4 Acceptable engagement range to MM8930-2620

3.3 The machine's hole diameter for attachment probe.

To accept +/-0.5mm against the hole center of MM8930-2620B, please design the machine by Figure 5.

To distinguish RF measurement probe from Antenna measurement probe by flange design, please design the positioning pin by Figure 5.

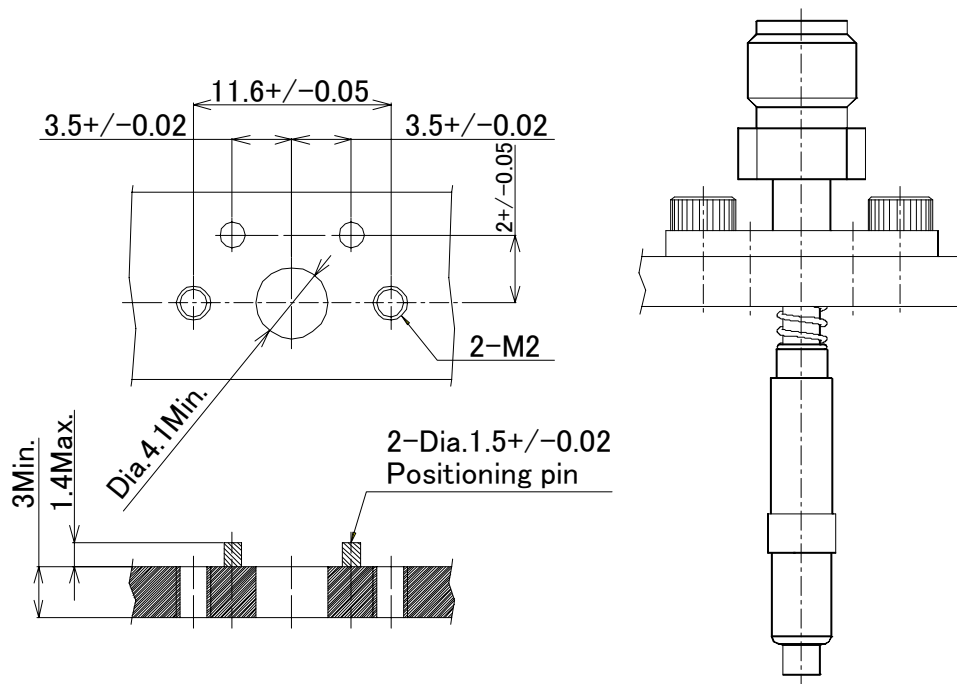

UNIT: mm

Figure.5 Machine's hole diameter for attachment probe



Preliminary Specification of COAXIAL CONNECTOR

Part Number : TSC3489PV

- 3.4 The slant angle tolerance of probe against MM8930-2620B. (Figure 6)
To have the stable measurement, TSC3489PV slant angle must be $\pm 2^\circ$.

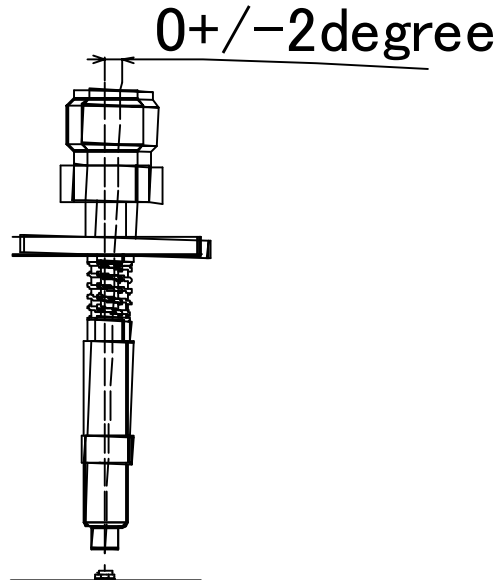


Figure.6 Probe Shape Operation Manual for Auto Measurement probe (TSC3489PV)

4. CAUTION

Limitation of Applications

Please do not use our products for the applications listed below which require specially high reliability for the prevention of defects which may directly or indirectly cause damage to the third party's life, body or property.

- (1) Aircraft equipment
- (2) Aerospace equipment
- (3) Undersea equipment
- (4) Power plant control equipment
- (5) Medical equipment
- (6) Transportation equipment (vehicles, trains, ships, etc.)
- (7) Traffic signal equipment
- (8) Disaster prevention / crime prevention equipment
- (9) Data-processing equipment
- (10) Application of similar complexity and/or reliability requirements to the applications listed in the above.